

**Technical Note TN143**

**Rehabilitation Technique and Treatment Prioritisation  
Method of Plain Concrete Pavements (PCP)**

**May 2021**

## Copyright

© The State of Queensland (Department of Transport and Main Roads) 2021.

## Licence



This work is licensed by the State of Queensland (Department of Transport and Main Roads) under a Creative Commons Attribution (CC BY) 4.0 International licence.

## CC BY licence summary statement

In essence, you are free to copy, communicate and adapt this work, as long as you attribute the work to the State of Queensland (Department of Transport and Main Roads). To view a copy of this licence, visit: <https://creativecommons.org/licenses/by/4.0/>

## Translating and interpreting assistance



The Queensland Government is committed to providing accessible services to Queenslanders from all cultural and linguistic backgrounds. If you have difficulty understanding this publication and need a translator, please call the Translating and Interpreting Service (TIS National) on 13 14 50 and ask them to telephone the Queensland Department of Transport and Main Roads on 13 74 68.

## Disclaimer

While every care has been taken in preparing this publication, the State of Queensland accepts no responsibility for decisions or actions taken as a result of any data, information, statement or advice, expressed or implied, contained within. To the best of our knowledge, the content was correct at the time of publishing.

## Feedback

Please send your feedback regarding this document to: [tmr.techdocs@tmr.qld.gov.au](mailto:tmr.techdocs@tmr.qld.gov.au)

## 1 Statement

This technical note provides guidance on the rehabilitation technique and treatment prioritisation method of the existing plain concrete road pavements (PCPs) where the pavements are outside the defect liability and warranty periods. The details within this document have been compiled from:

- practitioners' field experiences
- collated pavement testing data
- Technical Specifications (Measurements) MRS39 *Lean Mix Concrete Sub-base for Pavements* and MRS40 *Concrete Pavement Base*
- supplementary specification MRSS *Concrete pavements – Slab Replacement*
- supplementary specification MRSS *Supply of Concrete for Rapid Concrete Pavement Slab Replacement*, and
- Roads and Maritime Services New South Wales (NSW) concrete pavement specifications and drawings for concrete pavement maintenance.

To request a copy of the supplementary specification/s referenced within this technical note, please email [ET\\_PMG\\_Director\\_Pavement\\_Rehabilitation@tmr.qld.gov.au](mailto:ET_PMG_Director_Pavement_Rehabilitation@tmr.qld.gov.au) and for comprehensive details on the rehabilitation of PCPs, refer to the Pavement Rehabilitation Manual.

## 2 Background

Major PCP projects (mostly un-dowelled) in Queensland are listed following:

- Ipswich Road (part of Cunningham Arterial Road, now part of the Ipswich Motorway) approximately 5.6 km long. This section was constructed in 1952 and, by 1983, was in poor condition. The entire section was 'cracked and sealed' and overlaid with 125 mm asphalt in 1987.
- The Bruce Highway at Sippy Downs Sunshine Coast, approximately 5 km long, was constructed in 1986 / 1987.
- The Bruce Highway at Yandina Bypass Sunshine Coast, approximately 7 km long, was constructed in 1997.
- The Pacific Highway at Reedy Creek, approximately 3 km long, was constructed in 1982.
- The Pacific Highway from Reedy Creek to Tugun, approximately 9 km long, was constructed in 1997.
- The Pacific Motorway M1 Gold Coast (contracts two, three and four) approximately 34 km long. This is the largest PCP project (consisting of the eight lanes) that was constructed from approximately 1997 to 2000.

These PCPs are in various conditions. The Department of Transport and Main Roads (the department) carries out regular surveillance and maintenance to ensure their serviceability level.

### 3 Purpose of document

The purpose of this document is to assist inspection and diagnosis of PCPs. This documentation includes a decision flowchart to be used for guidance on the identification, evaluation and rehabilitation of PCPs.

### 4 Related documents

The documents listed in Table 4 provide further information to that contained in this Technical Note.

**Table 4 – Related documents**

<b>Publisher / Author</b>	<b>Document title</b>
Department of Transport and Main Roads	<i>Pavement Rehabilitation Manual (2020)</i>
GH Smith B – (Metro South), Department of Transport and Main Roads	<i>Rehabilitation of Existing Concrete Slabs on Ipswich Road, Queensland, (Undated, likely 1987)</i>
Alan Carse	<i>Performance of Concrete Pavements: An Overview, Queensland (1999)</i>
Burks Green	<i>Concrete Pavement Maintenance Manual. Berkshire, UK: The Concrete Society, (2001)</i>
Transport for NSW	<i>Pavement Standard Drawings, Rigid Pavement, Standard Details, Maintenance MD, M10, MP, Volume MP, Plain Concrete Pavement (PCP) Edition 3 Revision 1, NSW (2015)</i>
Transport for NSW	<i>QA Specification M212: Routing and Sealing of Cracks (Concrete Pavement) NSW 2020</i>
Transport for NSW	<i>QA Specification M213: Cross stitching of Cracks and Joints (Concrete Pavement) NSW 2020</i>
Transport for NSW	<i>QA Specification M215: Repair of Surface Spalls in Concrete Pavement, NSW 2020</i>
Transport for NSW	<i>QA Specification M231: Pressure Grouting for Slab Jacking / Stabilisation NSW 2020</i>


### 5 Existing condition evaluation

To understand which treatment methodology to apply to an existing PCP, the following process of information gathering and evaluating should be considered. This process should be considered to assess the existing asset condition.

1. Pavement historical data – establish from past pavement rehabilitation and investigation reports, Road Management Information System data, as constructed plans, verbal information from local district engineers / technical officers.
2. Defect mapping survey – assess surface condition, classify and quantify the defects (refer Figure 5 example of distress modes).
  - a. laser defect mapping, or
  - b. manual pavement defect mapping / walkover defect mapping inspection.
3. Laser height mapping survey – assess and quantify slab faulting.

4. Ground Penetrating Radar (GPR) survey – understand subsurface conditions such as pavement profile and thickness, existence of dowels and existence of reinforcements, detect anomalies (possible voids and moisture).
5. Pavement investigation – understand pavement profiles and characteristic properties and calibrating the GPR survey results. Sample investigation method:
  - a. concrete coring (minimum 150 mm diameter) – to calibrate concrete base and lean mix sub-base thickness and to assess concrete pavement structural condition, and/or
  - b. augering – to calibrate unbound or fill layer thickness, collect unbound samples and to expose sub-grade material for further insitu Dynamic Cone Penetration test.
6. Void detection
  - a. GPR survey and followed by concrete coring to verify true extent of voids
  - b. falling weight deflectometer – adopt variable load corner deflection analysis methods (zero load deflections) and corner deflection profile methods, and/or
  - c. steel crowbar – tap concrete slab and assess rebound sound.

**Figure 5 – Example some of distress modes**

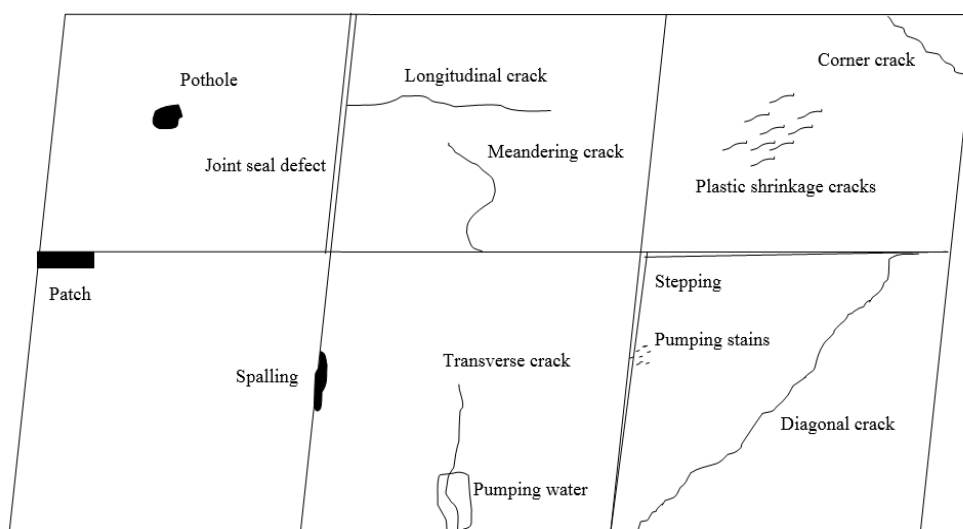


It is important to clearly understand the distinction between the types of pavement failure mechanisms when identifying and assessing distress types, cause of failure and developing rehabilitation strategies. A rehabilitation project may not adequately correct the pavement deficiency with an incorrect classification of the failure mechanism.

## 6 Detailed treatment prioritisation and identification


Figure 6(a) Flowchart 1 following has been developed by the department's Pavement Rehabilitation Unit to handle and analyse the data collected during the existing condition evaluation. The flowchart illustrated assists with treatment prioritisation and identifies the likely suitable treatment method to rectify failed concrete pavements.

Within Flowchart 1, 'C' is defined as the combined cracking length in a slab and 'L' is the slab length as shown in Figure 6(b), following.

Figure 6(a) – Flowchart 1 - Plain concrete pavement rehabilitation treatment prioritisation and identification

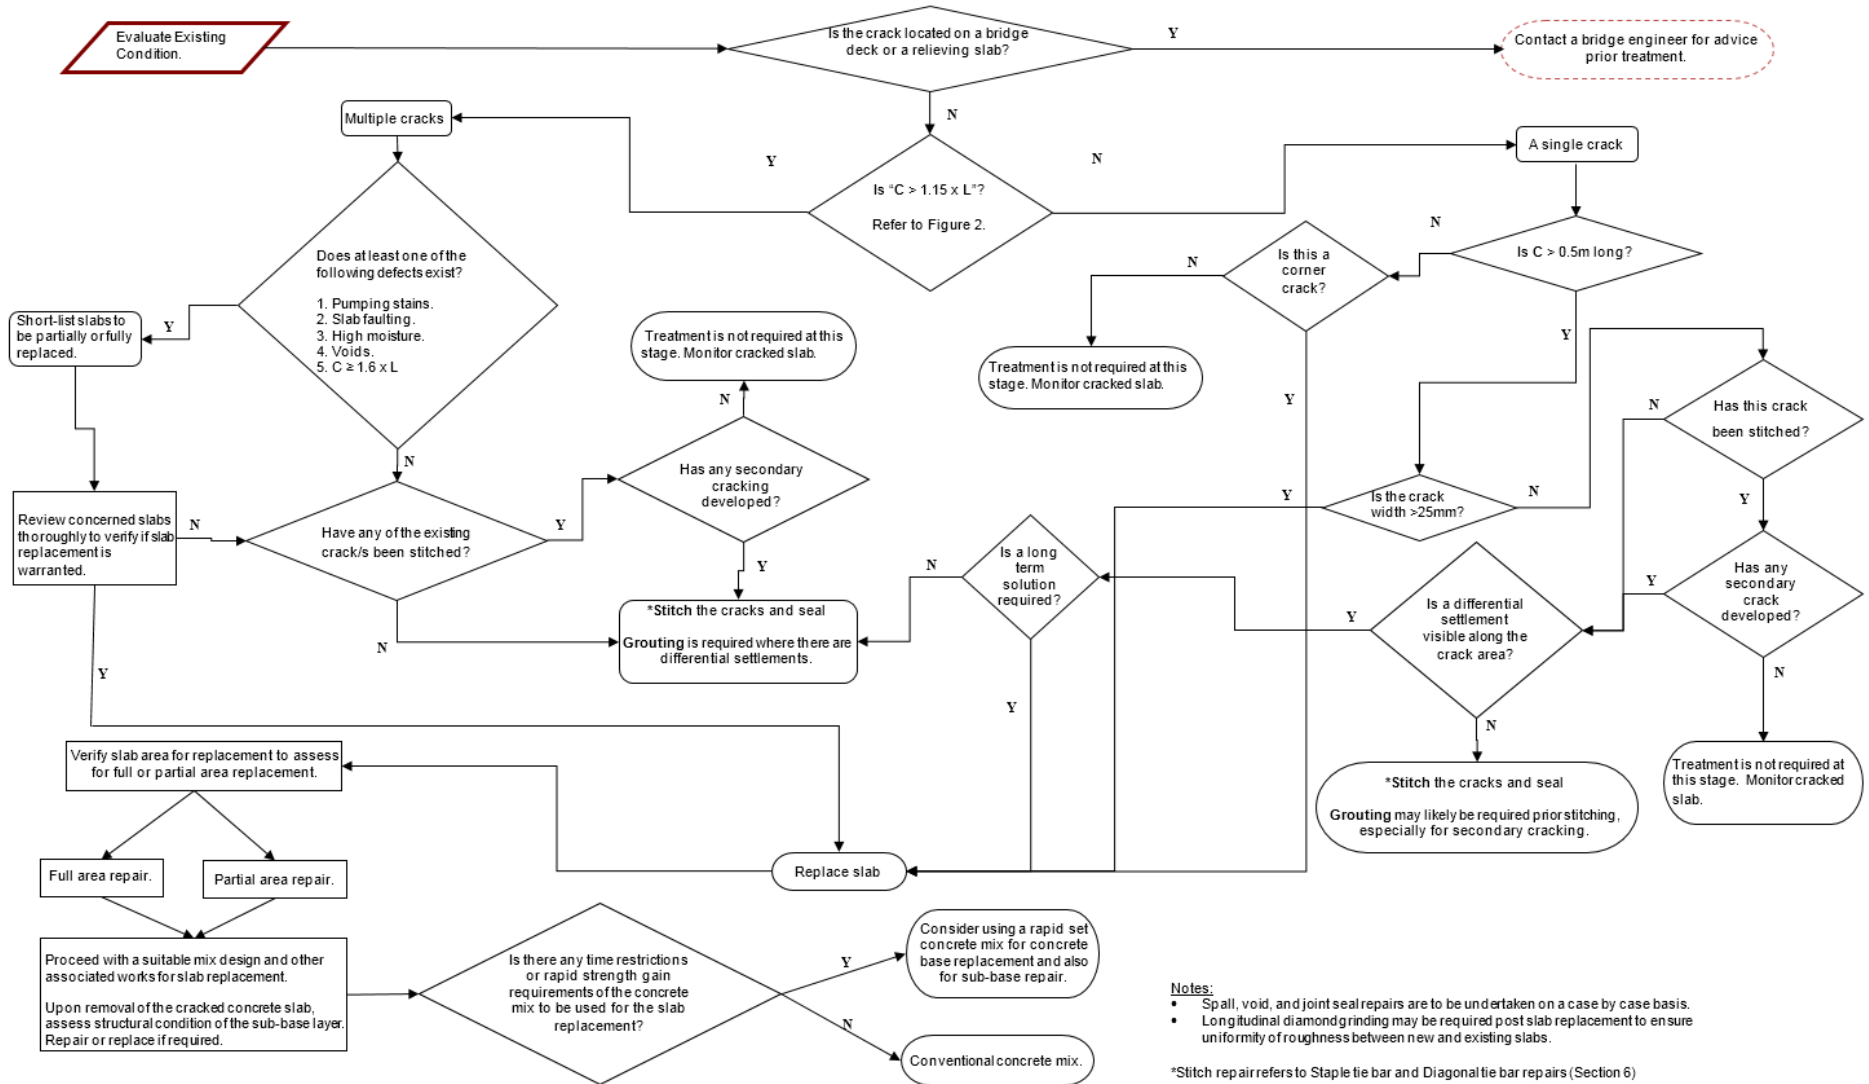

**Figure 6(b) – Cracking length (C) and slab length (L)**

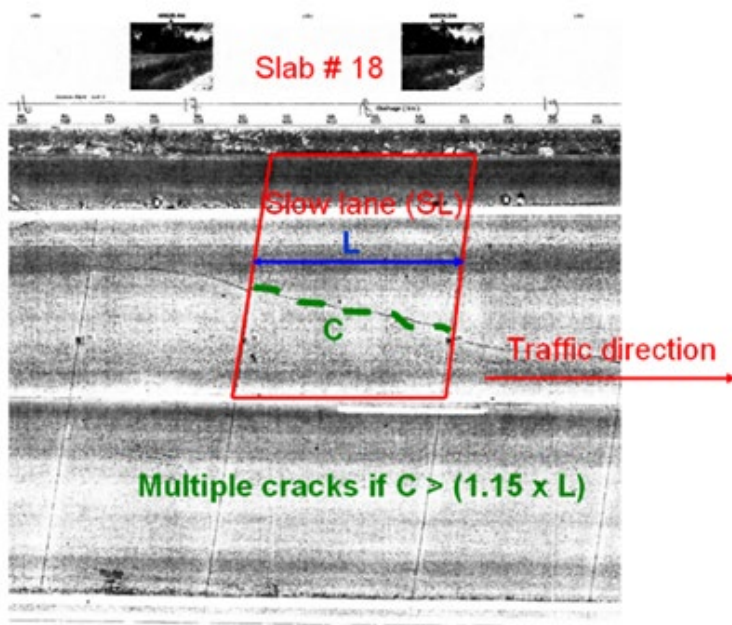


## 7 Treatment summaries

Roads and Maritime Services (RMS) NSW has developed standard drawings and specifications for the PCP treatments. These technical documents have been developed to suit NSW conditions. Upon discussion / approval from the Administrator, part of these standard drawings and specifications may be adopted for Queensland-based projects. Alternatively, the Principal Contractor shall submit work method statements to the Administrator for approval. The following section defines the treatments as identified in Flowchart 1 previously.

- **Spall repair** – spalling at joints can be caused from curling / warping stresses, but also by the penetration of incompressible material into the joint causing cracking when the slab expands. Partial depth repairs may be used to repair spalled areas at joints and cracks. Spalls should be treated before they extend below the top third of the slab. As a general rule, the ‘limits’ of a repair area for a spall should be made with a concrete saw, square or near square in shape and at least 50 mm beyond the limit of any spalling. The depth of sawing of the repair area should be greater than the depth of spalling at the edge of the spalled area and not less than 50 mm. All loose spalled material should be removed from the base of the spalled area prior to repair. Refer to technical guidelines.
- **Joint or crack sealing** – silicone sealing of exposed cracks or joints. Bitumen sealing is not recommended for this process as it is likely to be very temporary and unsightly. Refer to technical guidelines.
- **Diagonal tie bar repair (cross stitch)** – insert reinforced steel rods diagonally and epoxy resin to hold the crack together. It is used only for cracks or joints that are not intended to open / close and is generally unsuited to concrete slab thicknesses less than 190 mm and when the cracking gap is greater than 25 mm. Refer to Figures 7(a), 7(b), 7(c), 7(d), 7(e), 7(f), 7(g) and 7(h) following for technical guidelines.


**Figure 7(a) – Diagonal tie bar repair**

Base thickness D (mm)	Offset: drill hole to crack L <sub>c</sub> (mm)	Length of drill hole L <sub>h</sub> (mm)	Length of stitch-bar L <sub>b</sub> (mm)	Length of protection L <sub>p</sub> (mm)
190	165	330	280	40 ± 5
200	175	350	300	40 ± 5
210	180	370	320	45 ± 5
220	190	390	340	45 ± 5
230	200	410	360	45 ± 5
240	210	430	380	50 ± 5
250	215	450	400	50 ± 5

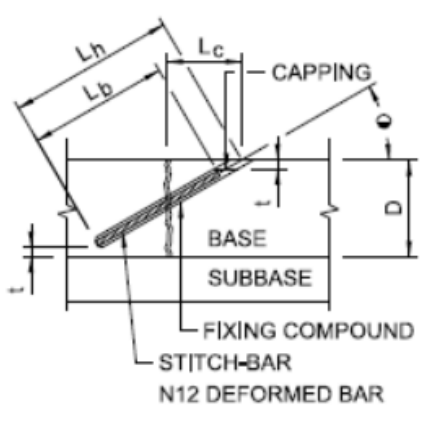

Notes:

1. To suit drill angle of 30° and cover (ct) of 25 mm, refer to above diagram.
2. See Figure 7(b) following for protection details (L<sub>p</sub>). Protection must be provided if the crack is wider than 0.5 mm. The suitable protection is by bituminous paint with a thickness of 0.2 mm to 0.5 mm.

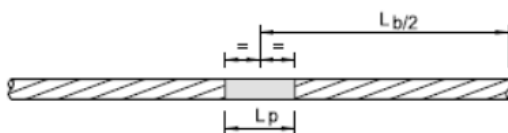
**Figure 7(b) – Stitch bar protection – L<sub>p</sub>**

**Figure 7(c) – Cross stitching of longitudinal crack**


Courtesy of John Hodgkinson




- Staple tie bar repair** - tie slabs together at cracks or joints to evenly distribute the load across both the crack and un-dowelled concerned joint. The implementation of the staple tie bar repair in Queensland has been limited, when compared to the diagonal tie bar repair (cross stitching). This treatment has been undertaken on several existing longitudinal cracks on the concrete slabs on the Bruce Highway, Sippy Downs area.

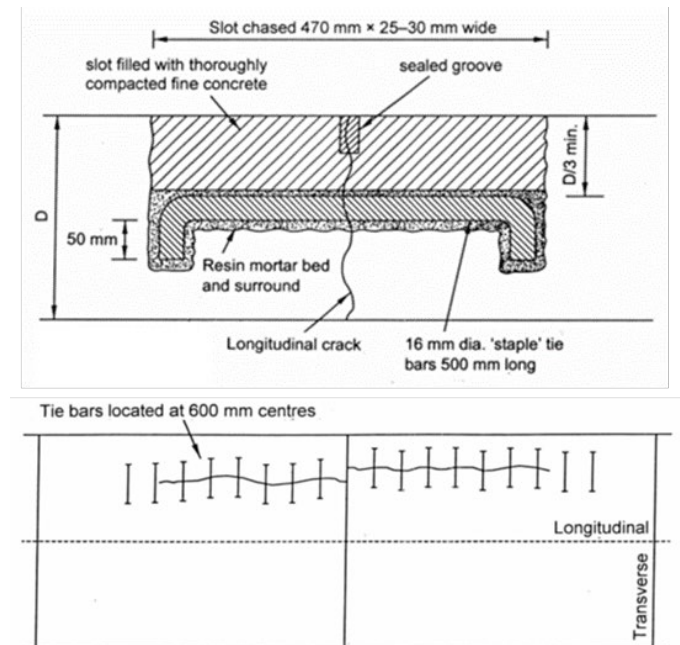**Figure 7(d) – Staple tie bar repair**



**Figure 7(e) – Staple tie bar repair at concrete pavement of Bruce Highway on Sippy Downs – Northbound Slow Lane from approximately Chainage 64,339 km–64,360 km**

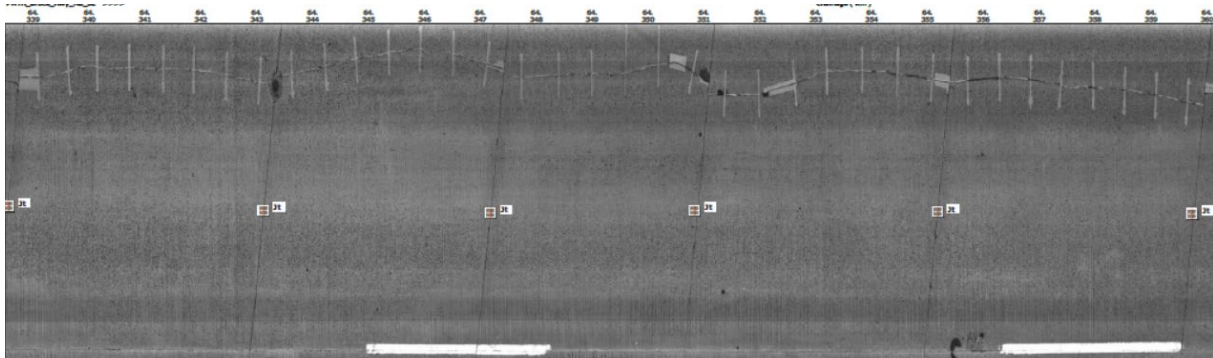

- Slab replacement:** removing partial or full area of the existing slab to the full concrete base depth and replacing it with new concrete. Refer to the Concrete Pavement Maintenance Standard Drawings Volume MP: Plain Concrete Pavement (PCP) for detailed slab replacement procedures for technical guidelines. Consideration of any time restrictions or rapid strength gain requirements, should be considered when deciding concrete mix design (that is, rapid set concrete or conventional concrete mix).

- **Pressure Grout injection for slab stabilisation:** it restores support to concrete slabs by filling voids that develop underneath the concrete slab at joints, cracks or the pavement edge. Slabs that have 'dropped' can be lifted by the grout pressure to restore the surface profile to match surrounding slabs. In general, voids can be formed at different pavement strata which determine the target grouting depth as follows:
  - shallow grouting: target voids between concrete base layer and a sub-base layer, and/or
  - deep grouting: target voids below the sub-base layer; that is, granular layer, fill, sub-grade replacement layer or sub-grade layer.

Currently, there are two common grouting techniques in Queensland:

1. cementitious grouting, and
2. expanding polyurethane foam grouting.

The cementitious grouting mix is prepared on site. A site setup should allow a working space for on-site grouting mix production; that is, stack of cement bags, mixing chamber and a grouting pump. Upon grouting completion, a specified curing time is required prior to opening for traffic. The required grouting holes are generally of minimum 30 mm in diameter and need to be plugged using an epoxy material.

For the expanding polyurethane foam grouting, the premix grouting liquid is stored in a vacuumed tank and is delivered on site in a tanker truck. The truck is equipped with a pressure pump to inject the expanding polyurethane directly to the grouting holes. The required site preparation is minimal compared to the cementitious grouting, but usually costs more than the cementitious grouting. The grouting holes are generally 10 mm to 15 mm in diameter and can be plugged using the same grouting material (the expanding polyurethane foam grouting). The grouting shall have a sufficient curing time to achieve the required strength prior to opening for traffic.

Depending on project specific requirements and site condition, the adopted grouting technique in a proposed project (cementitious vs polyurethane) shall be consulted and approved by the Administrator.


The following is a brief procedure of pressure grouting:

1. Carry out a one-day production field trial to establish a site-specific working procedure.
2. Submit proposed nominated grouting mix for approval. The minimum grout compressive strength shall be 8 MPa at 24 hours.
3. Set up locations of grouting holes to ensure vertical and horizontal filling of voids is achieved. The radius between grouting drill holes is usually between 1.5 m to 2 m. The grouting hole must not exceed 50 mm diameter. Refer to Figure 7(f) for details.
4. Determine the grouting depths. Insert a sleeve into the grout holes for a deep grouting below the sub-base concrete layer. The sleeve shall pass completely through the base concrete and sub-base concrete. Remove the sleeve after the grouting is completed.
5. Monitor the slab level regularly during void grouting or slab jacking using survey level equipment.


- During slab jacking, care needs to be taken when injecting the resin underneath the slab. The expansion of the resin needs to be monitored to ensure the slab raises to intended or designed level. Upon grouting completion, plug the grouting holes properly.

Refer to technical guidelines.

**Figure 7(f) – Typical grout hole arrangements for PCPs**

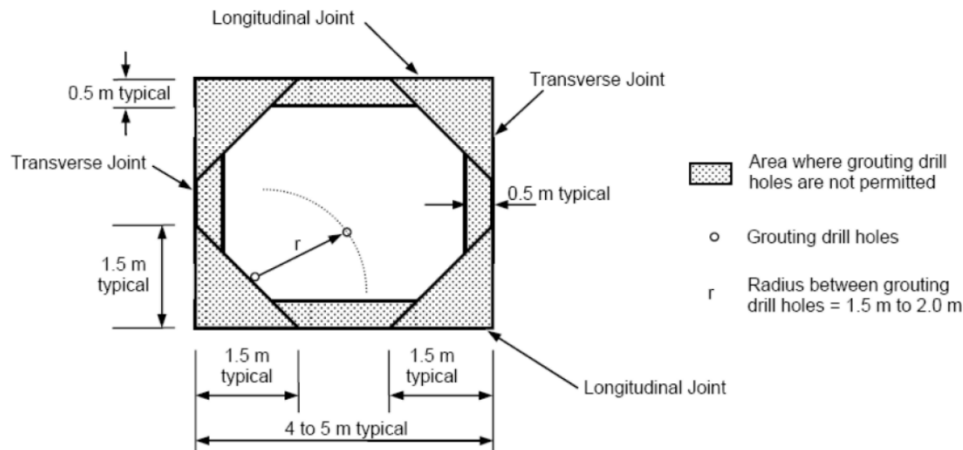

**Figure 7(g) – Pressure injecting grout using expanding polyurethane foam - Logan Hyperdome bus station**

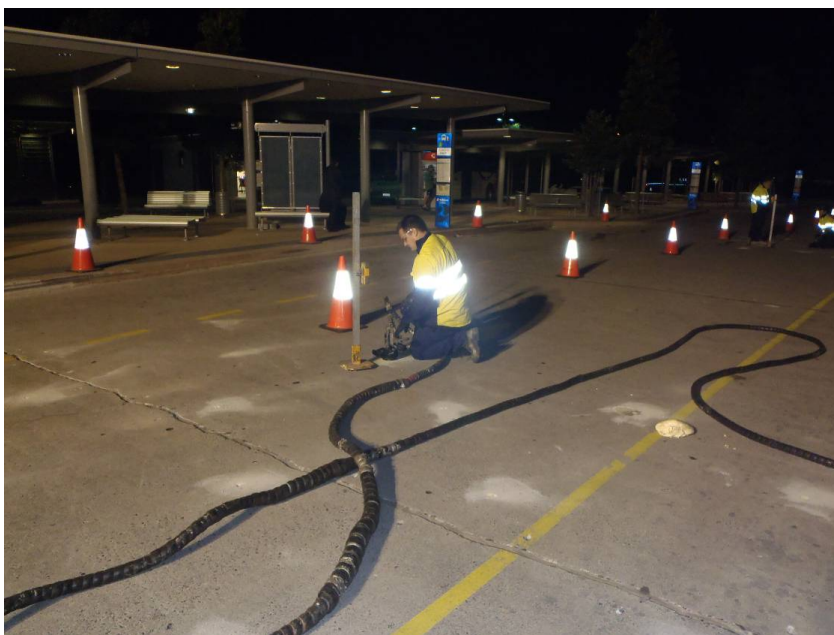

Courtesy of Jason Wilson

- **Longitudinal Diamond Grinding:** it restores or improves skid resistance, removes faults at joints or cracks by levelling the pavement surface and reduces traffic noise.

**Figure 7(h) – Diamond grinding in progress**



Courtesy of George Vorobieff, RMS, NSW

## **8 Monitoring**

As is the case with any pavement rehabilitation works, consistent monitoring is required post-restoration works to ensure treatments perform as intended and do not continue to deteriorate further.

## **9 Acknowledgement**

Jason Wilson (RoadTek, South Coast Region), John Hodgkinson (Tasman Associates Pty Ltd), Leah McKenzie and Peter Bell (Transport and Main Roads North Coast Region), and Mark Moro (Transport and Main Roads Contractor).

## **10 Author**

Transport and Main Roads Pavement Rehabilitation Unit.

